

## SEA-BIRD ELECTRONICS, INC.

1808 136th Place N.E., Bellevue, Washington 98005 USA Telephone: (425) 643-9866 Telex: 292915 SBEI UR

Fax: (425) 643-9954 email: seabird@seabird.com

## SBE P/N 50155

DATE	SYM	REVISION RECORD	AUTH	DR	CHK

# SBE 32 12/16 to SeaTech Fluorometer Mount Kit

### KIT CONTENTS

SBE P/N	Manufacturer P/N	Primary SBE Application	QTY
23746	SBE 32 to SBE 19 Mount Bar	Vertical Bar secures mount fixture to carousel	1
23838	SBE 32 to SBE 19 Mount Pin	Pin secures top of bar to Carousel Adapter Plate	1
23907	Modified ST Fluor Mount Plate	Bolts onto bar to secure ST Fluorometer to fixture	1

#### *HARDWARE*

SBE P/N	Part Description	Primary SBE Application	QTY
30178	Mach Screw, 10-24 x 3/4 FH	Securing bolts for ST Brackets to ST mount Plate	4
30254	Washer, ¼ Split Ring Lock	Used with Mount Plate to Bar Bolts (30360)	4
30259	Washer, 1/2" Flat, narrow	Used with Mount Pin securing screw (30603)	1
30360	Bolt, <sup>1</sup> / <sub>4</sub> -20 x 1" Hex	Mount Plate to Bar Bolts	4
30377	Bolt, 1/4-20 x 1-1/4 Socket	Securing bolts for ST Fluor brackets	2
30570	Washer, 1/4" Flat	Used with Mount Plate to Bar Bolts (30360)	4
30594	Washer, 1/2" Split Ring Lock	Used with Mount Pin securing screw (30603)	1
30603	Screw, ½-13 x 3-1/2" Socket	Mount Pin securing screw	1

# ST Mount Kit Assembly and installation

### A. Install Brackets onto Mount Plate

- 1. Inject bracket holes with DC-4.
- 2. Brackets install onto the flat side of the mount plate.
- 3. Threaded holes on brackets line up with countersunk holes on plate.
- 4. Secure from plate side with 4 screws (30178), sunk into he countersinks.

### **B.** Install Bar onto Mount Plate

- 1. Inject DC-4 into mount bar holes.
- 2. Mount bar snaps onto plate, such that all 4 bar holes line up with holes on the plate.
- 3. Slide lock washer then flat washer over threads of the bolts (30360) and secure bar to plate.


### C. Install Mount pin to secure fixture

- 1. Install onto carousel such that lower pin hole on bar fits over a pin on lower adapter plate.
- 2. Press until upper portion just slips in underneath upper adapter plate.
- 3. Slide lock washer then flat washer over bolt (30603) and slide bolt through the mount pin, such that head of bolt is contacting the larger flatter side of the pin.
- 4. Install pin through upper adapter plate, into the mount bar, and secure.

### D. Install ST Fluorometer into mount brackets

- 1. Lightly install 1 screw (30377) into each bracket securing hole.
- 2. Slide Fluorometer carefully through the brackets and tighten screws.

SBE DRAWING: 67082	Sea-Bird Electronics Procedure
TITLE, CDE 22 to CT Elegeneter Mount Vit	PROCEDURE NUMBER: 67082
TITLE: SBE 32 to ST Fluorometer Mount Kit	TITLE: SBE 32 ST Fluor Mount Kit
Assembly	REVISION:
DEV	EFFECTIVE DATE: <b>11/22/2002</b>
REV:	CHECKED BY: PAGE 1 of 1

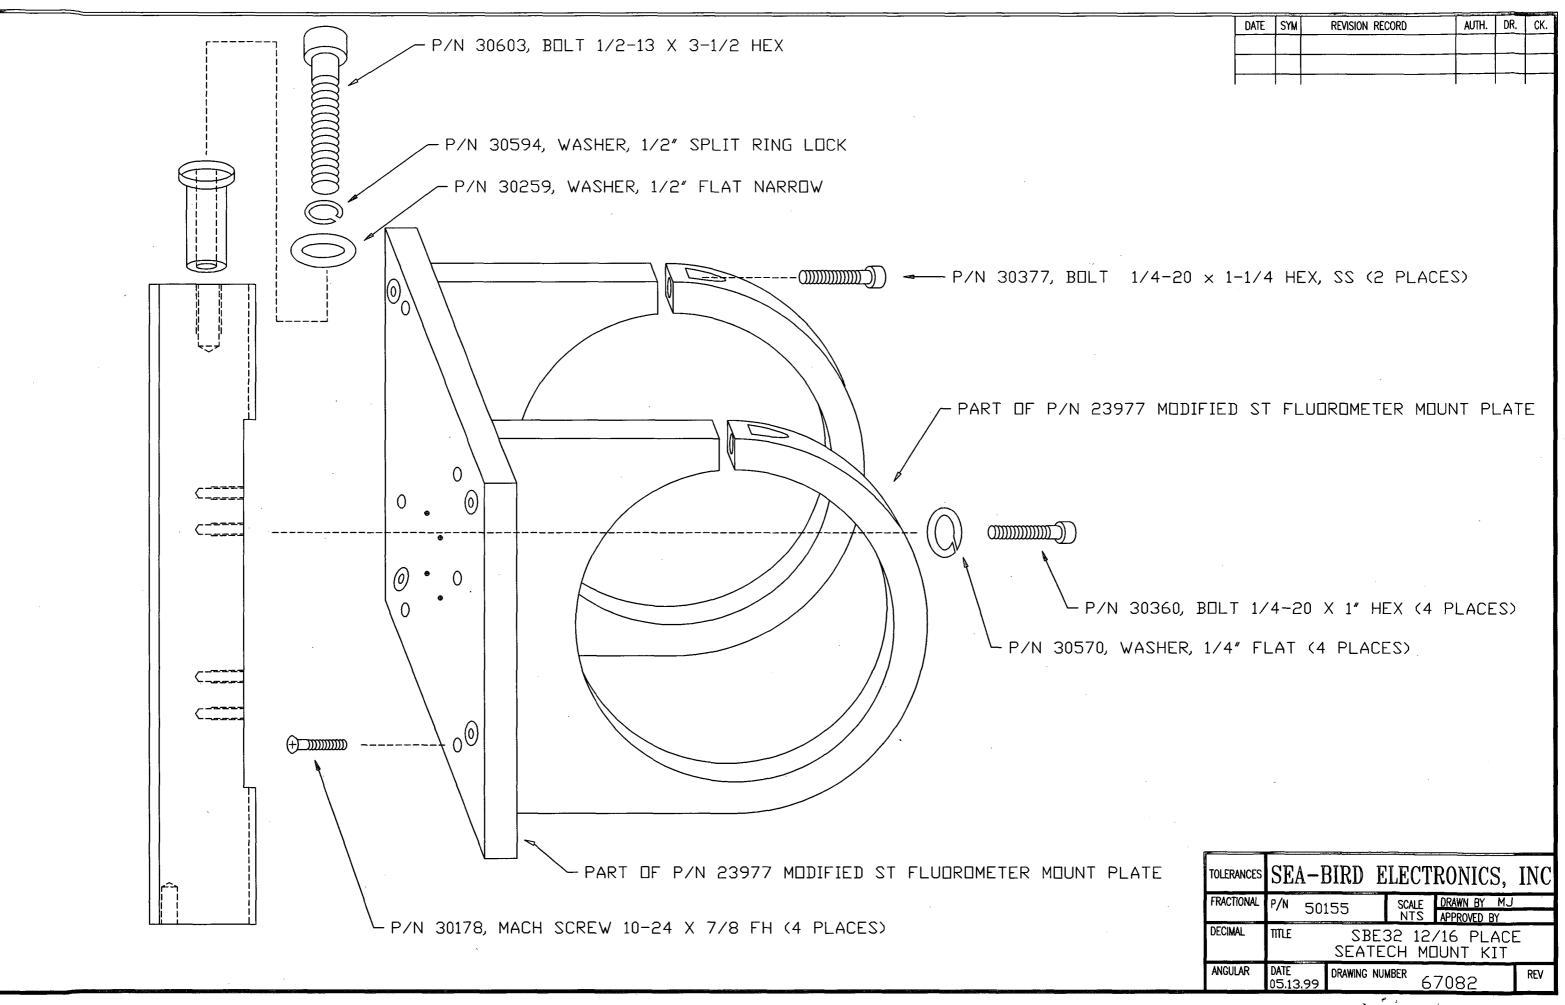

JO 1/1/1.